

Inspection Report (☒ 1 ST ☐ 2 ND)		PENDING	
☐ Pre-shipment ☐ ON-LINE ☐ IN PROCESS ☒ FULL			
Summary Section		Service Number: 2605091444099752	
	Product Name	Sealing strip	
	Item number	/	
	P/O number	/	
	Quantity	2020pcs	
	Client name	/	
	Supplier name	Hengshui Jianheng Technology Co., Ltd.	
	Inspection date	2026-5-12	
	Inspection location	Hengshui.Hbei,China	
	Inspector	Bruce Ge	

Category	Conform		Comment
1. Quantity	☒ YES	☐ NO	
2. Product description / style / color	☐ YES	☒ NO	Remark 1
3. Workmanship	☒ YES	☐ NO	Remark 3
4. Testing/ checking	☒ YES	☐ NO	Remark 2
5. Data measurement	☒ YES	☐ NO	
6. Packaging	☐ YES	☒ NO	Remark 4
7. Marking	☐ YES	☒ NO	Remark 5

OVERALL CONCLUSION	PENDING

Special Attention	
1. No sample for reference during inspection. Please kindly confirm that all of information is 100% correct. 2. Factory does not allow inspector perform caron drop test. 3. Inspectors inspected total 41 pcs of this shipment and found total 0 pcs with critical defects, _0_pcs with major defects and _3_pcs minor defects. The factory had reworked and replaced above all defects during inspection. 4. There are no ventilation holes on the plastic bag. 5. No marking.	

	
Defective products ☐ pick out ☒ replace ☒ rework ☐	

Remark Picture	

Advise for the inspection	
Require factory to rework and clean off all products on site.	

Carton packing:						
Item Name	Packing (pcs / carton)	Total carton	Carton size L × W × H (cm)	Carton G.W (Kg)	Carton Bar code	Bar code scanning
Sealing strip	600	3	49x40x39	10.15	N/A	N/A

Gift box packing:				
Item Name	Packing (pcs / Plastic	Plastic bag size L × W × H (cm)	Plastic bag N.W (Kg)	Gift box Bar code
Sealing strip	100	50x38	1.50	N/A

Product check:				
Item Name	Product size L (CM)	Product N.W (g)	UPC Bar code	Bar code scanning
Sealing strip	48.4	14.5	-	-

Export carton information:					
Carton:	New export carton	Yes	Sealing	Opaque gummed tape	/
Fastening:	Metal staples	No		Transparent gummed	Yes

Strapping:	Nylonx2	No		Paper tape	/
Material:	Ply of corrugated	5 Ply	Others:	-	/

Details Quantity

Item Name	Ordered Quantity	Total carton	Packed Quantity	Finished quantity	Not finished quantity	Sample from packed Qty.	Sample from Not packed Qty.
Sealing strip	2020	3	2020	2020	0	41	0
TOTAL	2020	3	2020	2020	0	41	0

Workmanship

Inspection Standard: ANSI/ASQZ1.4 (MIL-STD-105E)		DEFECTS		
		Critical	Major	Minor
Sampling plan: Single, Normal	AQL	0	2.5	4.0
Inspection Level: Full inspection	Defects Found:	0	0	3
Sample Size:	41pcs	Max. Allowed:	0	3
			3	5

Defectives List

Defectives Description		CRI	MAJ	MIN
1.	Dirty mark	0	0	3

Defectives PIC

	
Dirty mark-Min	Dirty mark-Min



Dirty mark-Min


N/A

N/A

Product description



Packing view

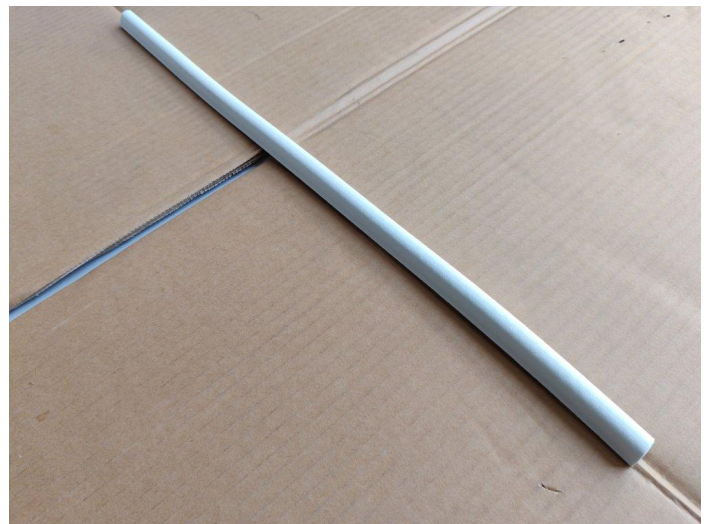


Product view




Product view




Product view

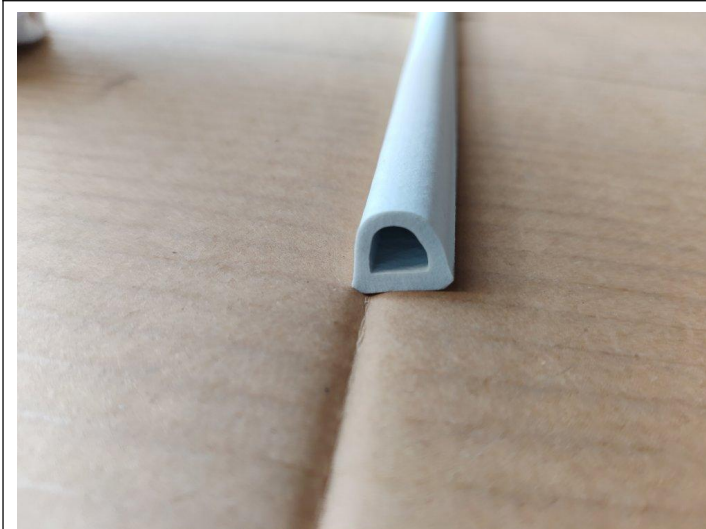


Product view

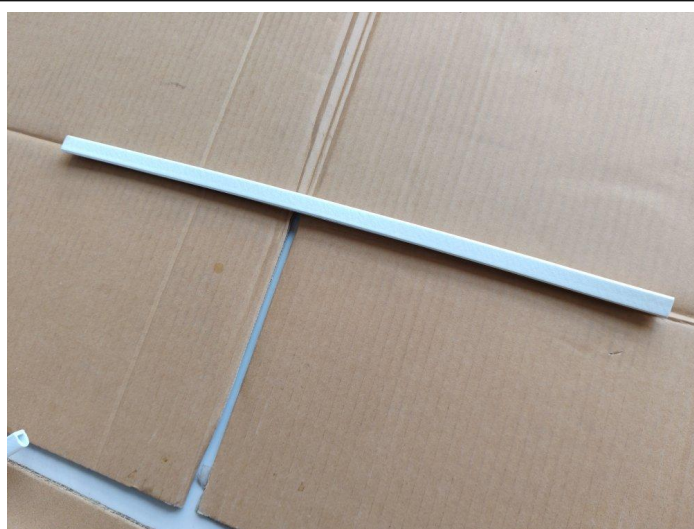

Product view

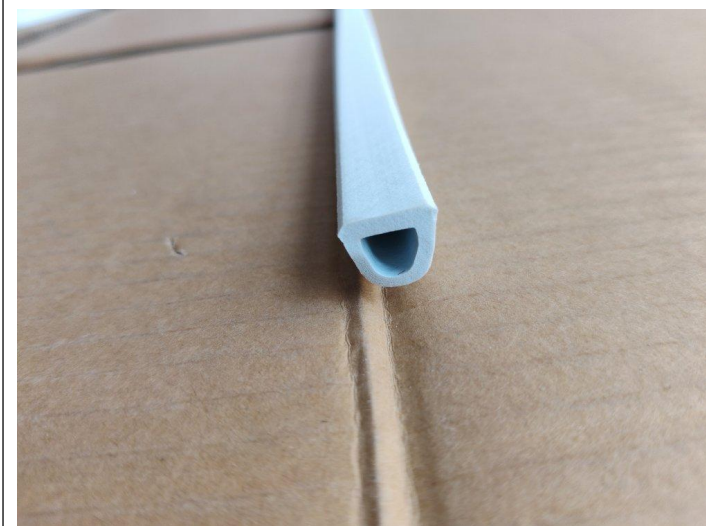

Product view

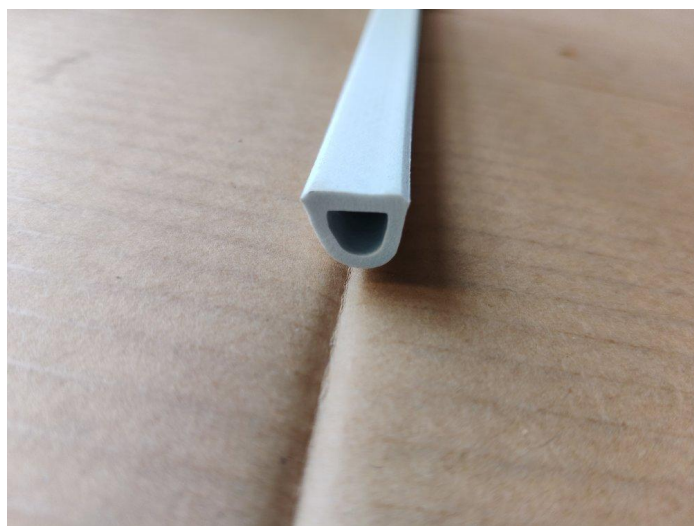

Product view

Size and weight



Carton weight check



Carton weight check



Carton size check




Carton size check



Carton size check



Carton size check

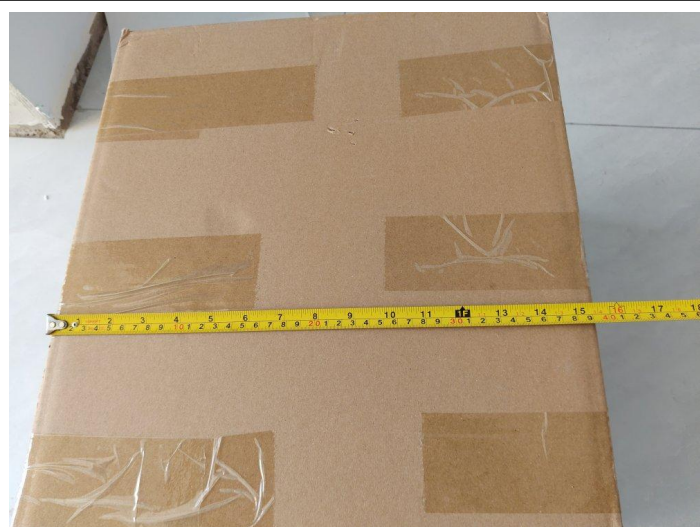

Carton size check




Carton size check



Gift box weight check



Gift box weight check

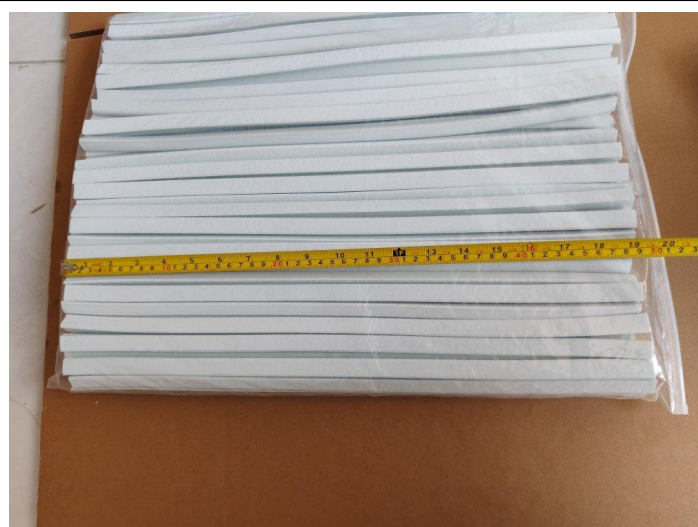

Gift box size check



Gift box size check



Gift box size check



Gift box size check



Product weight check



Product weight check



Product weight check




Product weight check



Product weight check




Product weight check

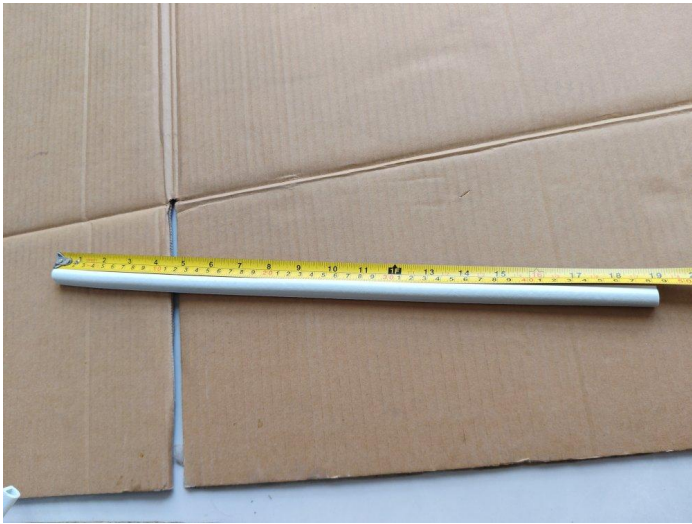


Product size check



Product size check

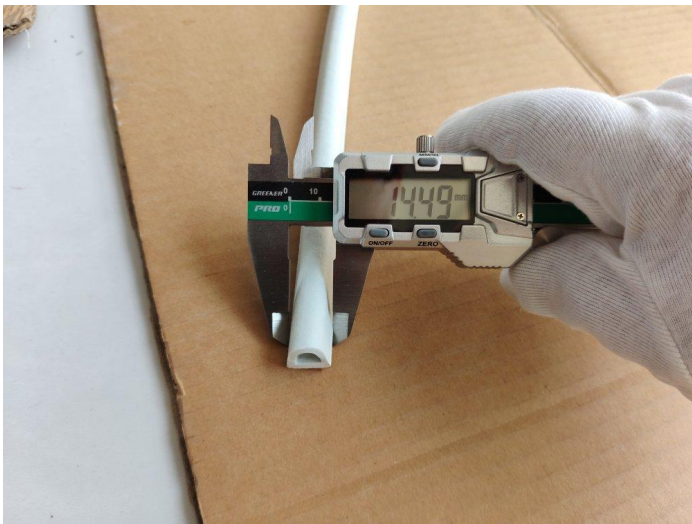

Product size check

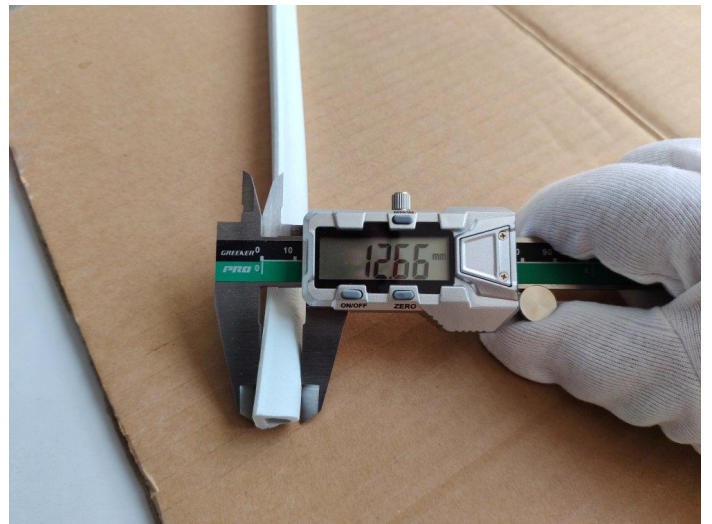

Product size check



Logo size check



Logo size check



Product size check



Product size check



Product size check



Product size check

PACKING



Carton view



Carton view



Open carton



5-ply



Plastic bag view



Plastic bag view



Packing view



Packing view



Packing view



Packing view

MARKING

SHIPPING MARK


N/A

N/A

TESTING



Smell test

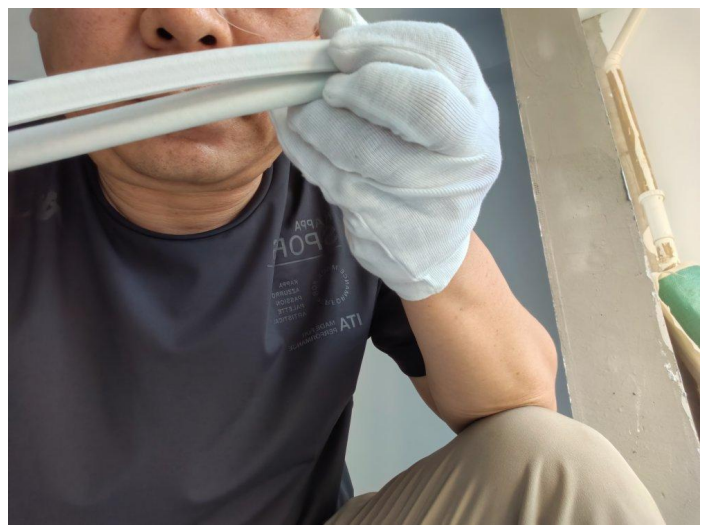

Smell test



Rebound test



Rebound test



Rebound test



Rebound test



Assembly test



Assembly test




Assembly test



Assembly test



Assembly test

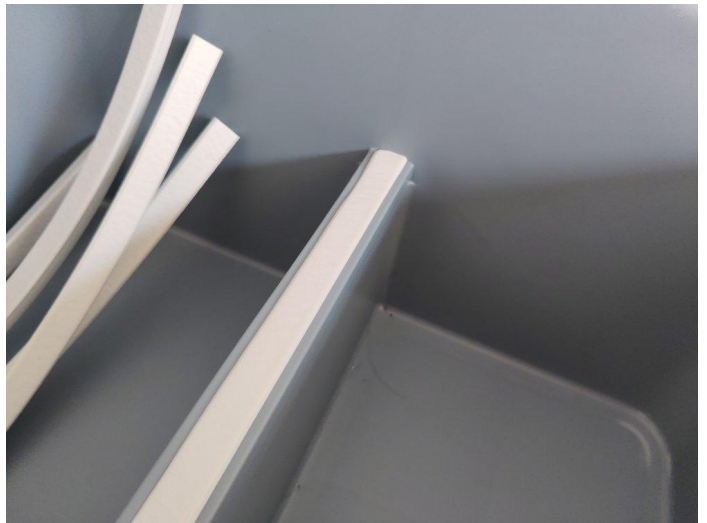

Assembly test

INSEPCION SPOT



Factory name



Mass product



Mass product



Mass product

Note: This report reflects our findings at time and place of inspection.

This report does not relieve suppliers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter.

-----END OF REPORT-----