

Inspection Report

(☒ 1ST ☐ 2ND)

☐ Pre-shipment ☐ ON-LINE ☐ IN PROCESS ☒ FULL

PENDING

Summary Section

Service Number: 20250926



Product Name	Mighty sink
Item number	Faucet-Gen-2
P/O number	/
Quantity	3000pcs
Client name	-
Supplier name	Xiaohongbao Technology
Inspection date	2025-09-29
Inspection location	Shenzhen, Guangdong
Inspector	Welsey

Category	Conform		Comment
1. Quantity	☒ YES	☐ NO	
2. Product description / style / color	☒ YES	☐ NO	
3. Workmanship	☒ YES	☐ NO	
4. Testing/ checking	☒ YES	☐ NO	
5. Data measurement	☒ YES	☐ NO	
6. Packaging	☒ YES	☐ NO	
7. Marking	☒ YES	☐ NO	

OVERALL CONCLUSION

PASS

Special Attention

1. All the defects have been repaired on site.

Defective products ☒ pick out ☐ replace ☐ rework

Remark Picture

N/A

N/A

Advise for the inspection

Require the factory to clean the site of all defective products.

Carton packing:

Item Name	Packing (pcs / carton)	Total carton	Carton size L × W × H (cm)	Carton G.W (Kg)	Carton Bar code	Bar code scanning
Faucet-Gen-2	20	150	/	/	/	/

Gift box packing:				
Item Name	Packing (pcs / BOX)	Gift box size L × W × H (cm)	Gift box N.W (g)	Gift box Bar code
Faucet-Gen-2	1	14.4*18.3*15.1	0.34	0199284627475

Product check:				
Item Name	Product size L (CM)	Product N.W (g)	UPC Bar code	Bar code scanning
Faucet-Gen-2	14*7*14	0.29	/	/

Export carton information:					
Carton:	New export carton	Yes	Sealing :	Opaque gummed tape	/
Fastening:	Metal staples	No		Transparent gummed	Yes
Strapping:	Nylonx2	No		Paper tape	/
Material:	Ply of corrugated	5 Ply	Others:	-	/


Details Quantity

Item Name	Ordered Quantity	Total carton	Packed Quantity	Finished quantity	Not finished quantity	Sample from packed Qty.	Sample from Not packed Qty.
Faucet-Gen-2	3000	150	3000	3000	0	3000	0
TOTAL	3000	150	3000	3000	0	3000	0


Workmanship

Inspection Standard: ANSI/ASQZ1.4 (MIL-STD-105E)		DEFECTS		
		Critical	Major	Minor
Sampling plan: Single, Normal	AQL	0	2.5	4.0
Inspection Level: Full inspection	Defects Found:	1	56	63
Sample Size:	3000 Sets	Max. Allowed:	0	-



Defectives List				
Defectives Description		CRI	MAJ	MIN
1.	Button turn on / off not working	1	0	0
2.	Button not sensitive	0	55	0
3.	Damaged	0	1	0
4.	Dirty mark	0	0	36
5.	Black dot	0	0	15
6.	Scratch mark	0	0	6
7.	Poor eletroplating	0	0	2
8.	The button is uneven	0	0	1
9.	Broken edge	0	0	1
10.	Poor assembly	0	0	1
11.	Button uneven , one side above the other side	0	0	1


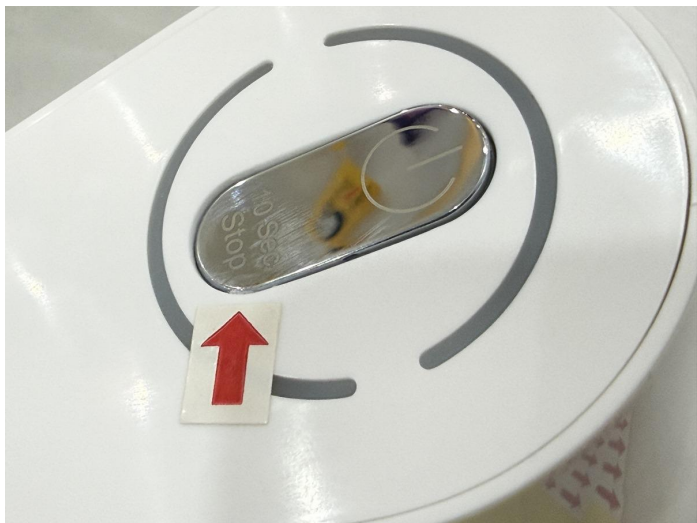
Defectives PIC	
Button turn on and off not working- Critical	
	N/A
Button not sensitive-major	
	



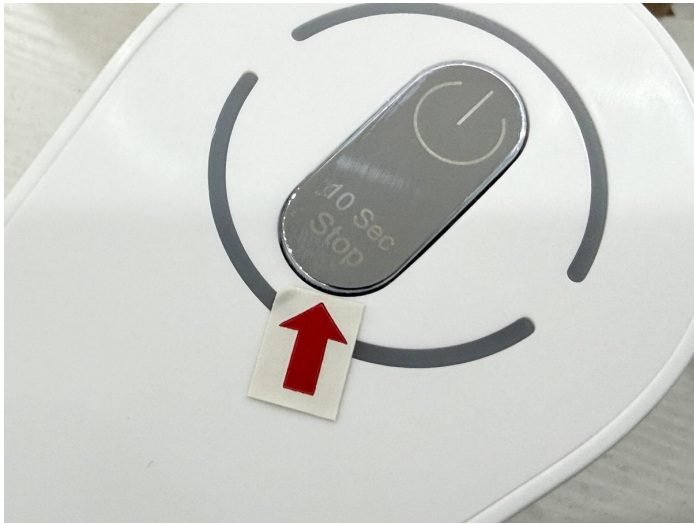


Dirty mark-minor

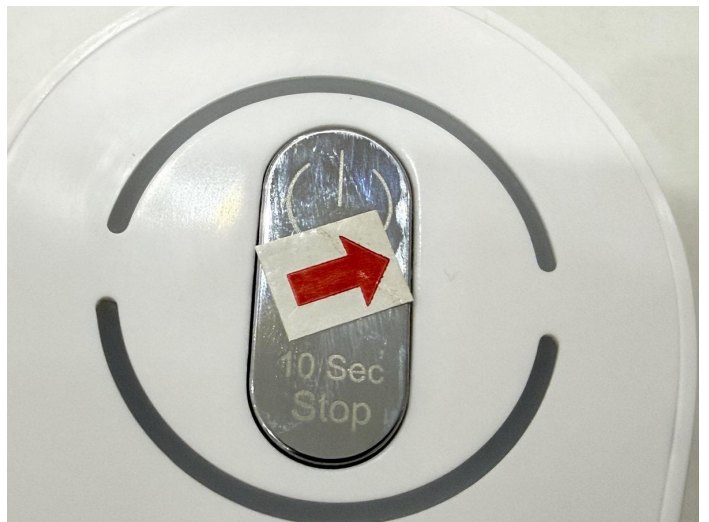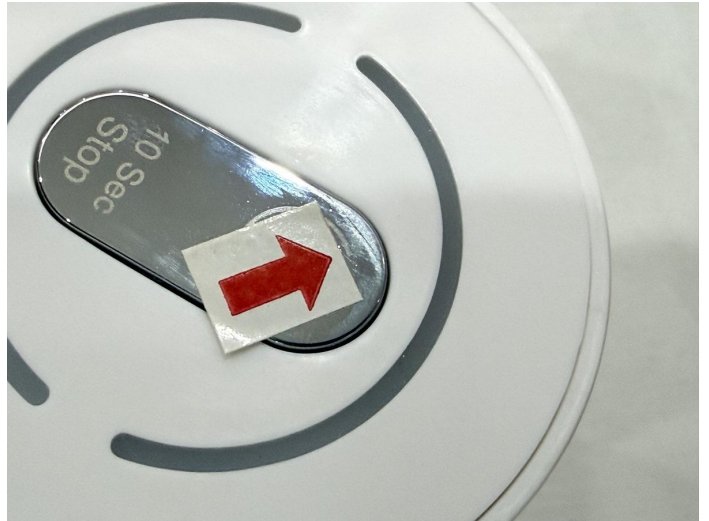

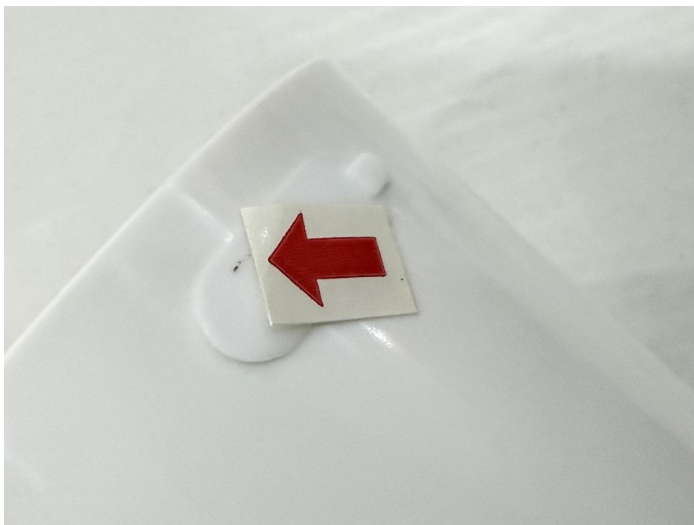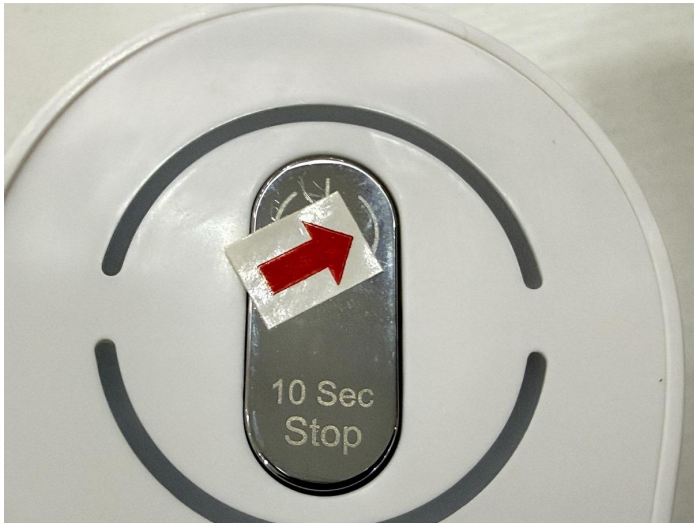

	
	
	N/A
Scratch mark	

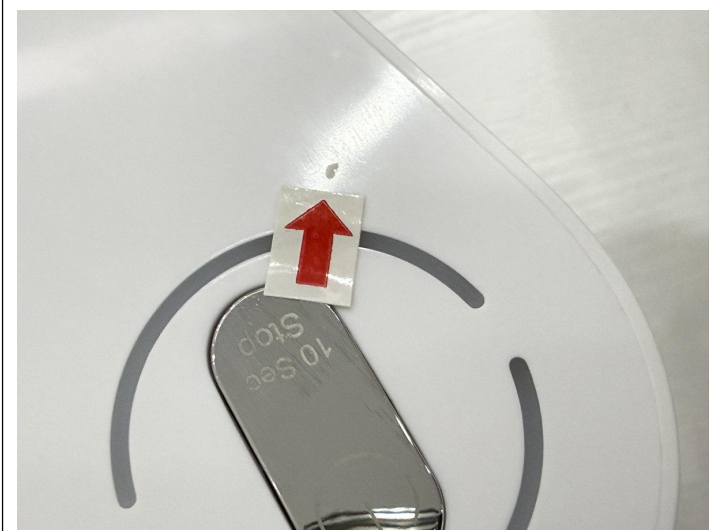

Poor electroplating-minor



N/A

Broken edge-minor



N/A

Poor assembly



N/A

Button uneven , one side above the other side



N/A


Product description



Product view



Product view

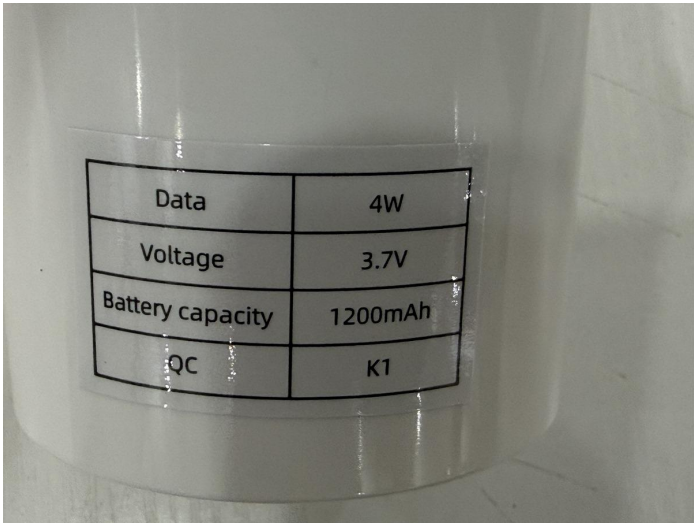

Product view



Product view



Product view



Product view



Product view



Product view




Product view




Product view



Product view

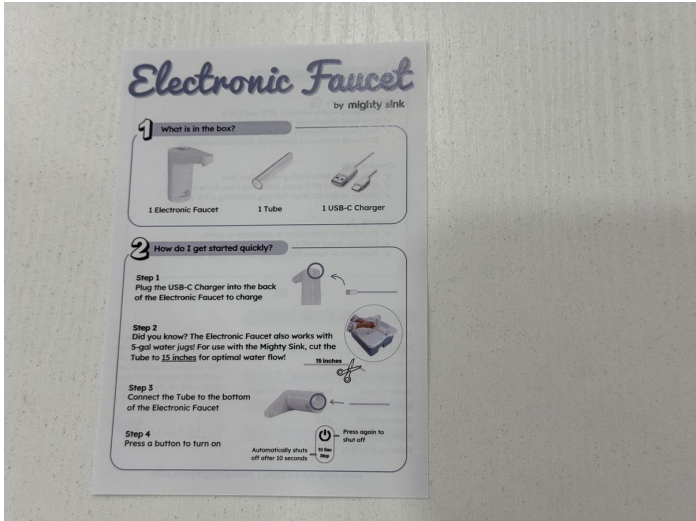

Product view

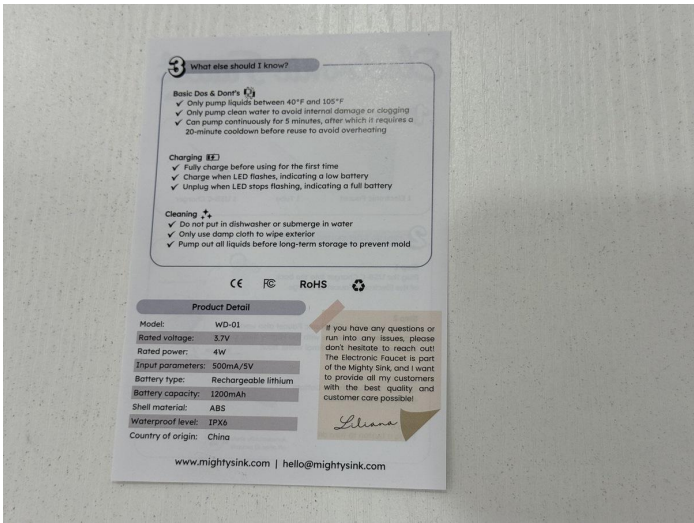

Product view

N/A

N/A

Size and weight



Gift box size check



Gift box size check



Gift box size check



Gift box size check



Gift box size check



Gift box size check



Gift box weight check



Gift box weight check



Product size check



Product size check



Product size check




Product size check



Product size check



Product size check

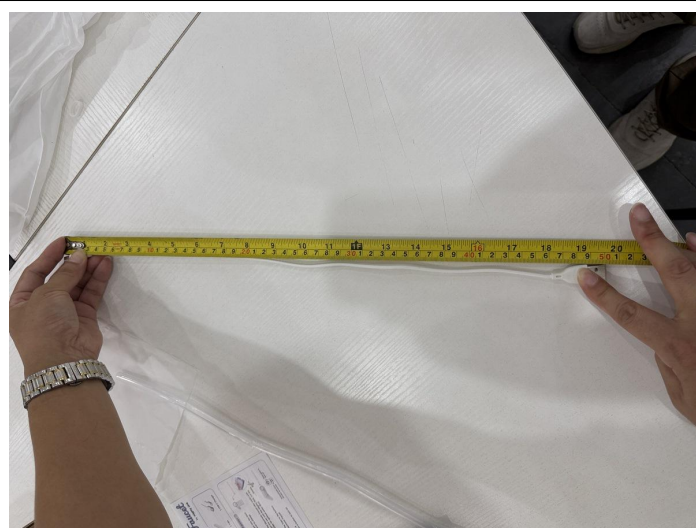



Product size check



Product size check



Product weight check



Product weight check



Product weight check



Product weight check



Product weight check



Product weight check



Product weight check



Product weight check

PACKING



Master carton



Master carton



Open carton view



Gift box view



Gift box view



Gift box view



Gift box view



Gift box view




Gift box view



Gift box view



Open the Gift box

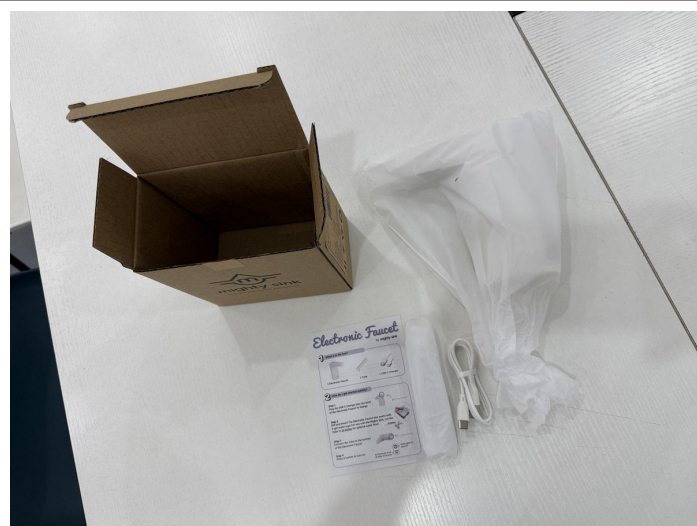

Open the Gift box



Unit packing



Unit packing




Unit packing



Unit packing



Unit packing

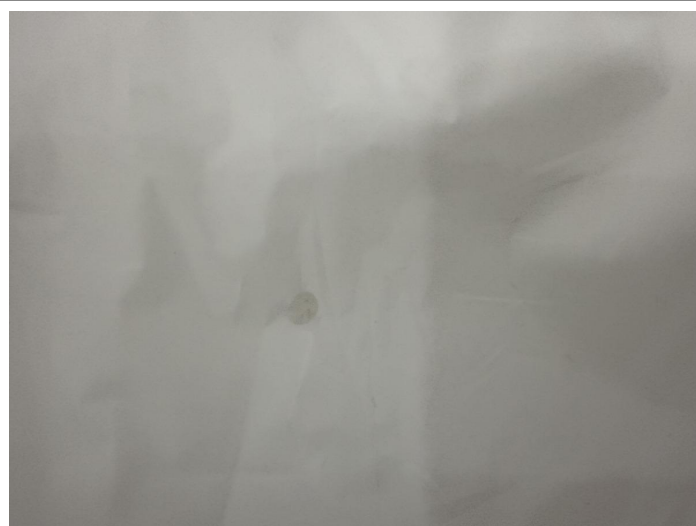

Unit packing

MARKING

SHIPPING MARK



Main mark



Side mark

TESTING



Adhesion test



Adhesion test



Adhesion test




Adhesion test




Barcode scanning test



Charging test

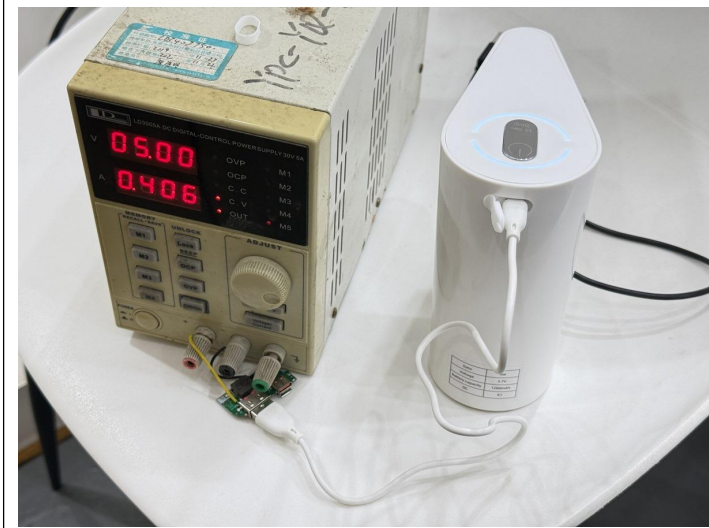

Charging test

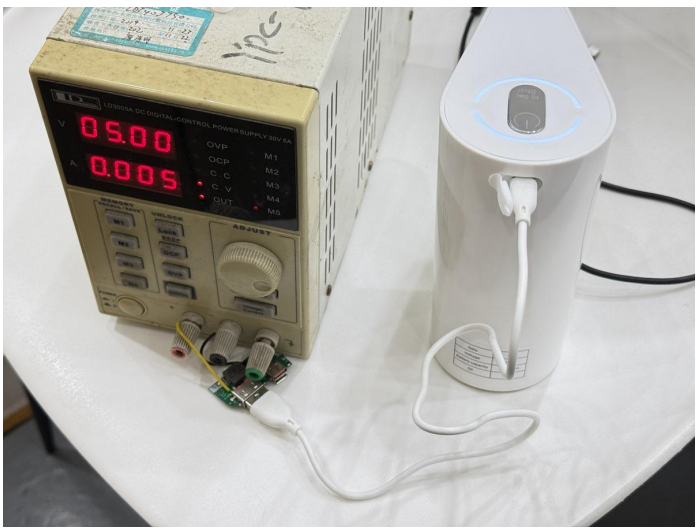

Charging test



Charging test

N/A

N/A

INSEPCION SPOT



Factory name

N/A

N/A

Note: This report reflects our findings at time and place of inspection.

This report does not relieve suppliers from their contractual liabilities or prejudice buyers' right for compensation for any apparent and/or hidden defects not detected during our random inspection or occurring thereafter.

-----END OF REPORT-----